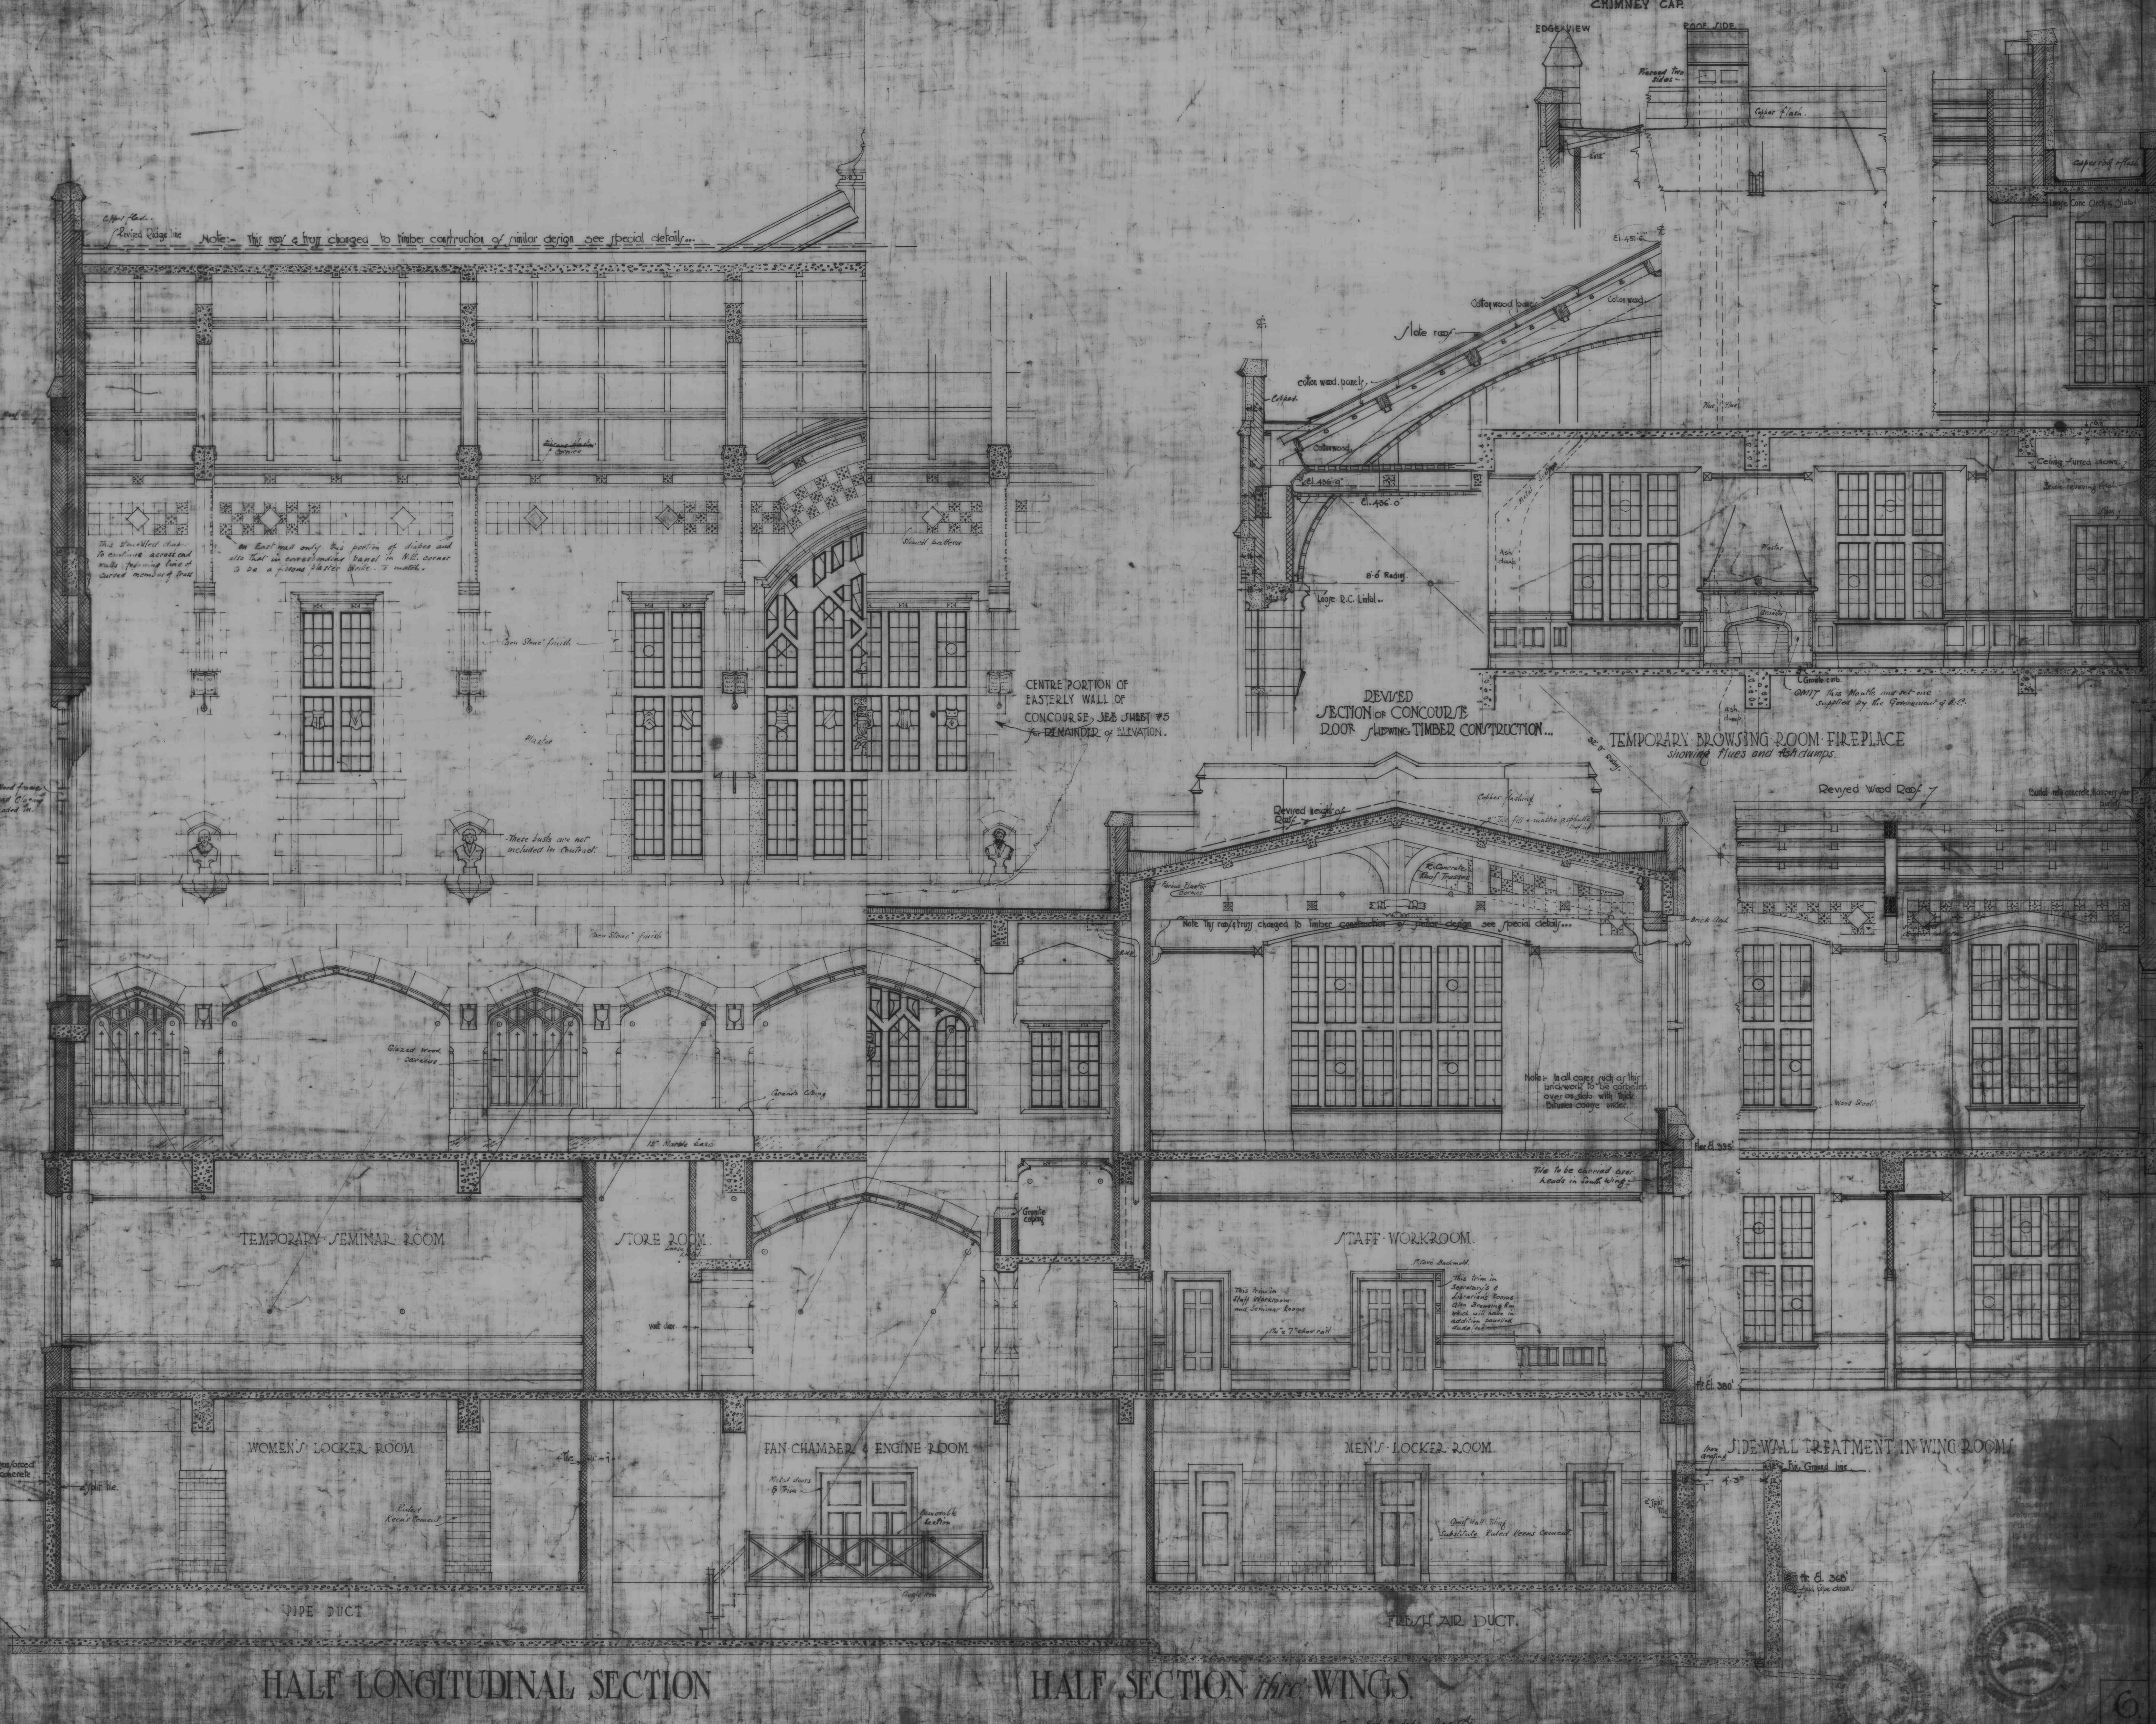
Copper flash.
Revised Ridge line
Note:- This roof & truss changed to timber construction of similar design see special details...
Future Roof
Fibrous plaster Cornice
This stencilled diap. to continue across end walls following line of curved member of truss
On East wall only this portion of diaper and also that in corresponding panel in N.E. corner to be a fibrous plaster Grille to match.
Caen Stone finish
Plaster
Wood frame Lead Glazing beaded in.
These busts are not included in Contract.
Stencil pattern
CENTRE PORTION OF EASTERLY WALL OF CONCOURSE, SEE SHEET #5 for REMAINDER of ELEVATION.
"Caen Stone" finish
Glazed Wood Cevecas
Granite Coping
12" Marble base
TEMPORARY SEMINAR ROOM
STORE ROOM
Loose R.C. Lintel
vault door
WOMEN'S LOCKER ROOM
4" Reinforced concrete
2" split tile
4" Tile
Ruled Keen's Cement
PIPE DUCT
FAN CHAMBER & ENGINE ROOM
Metal doors & Trim
Removable Section
Angle iron
Granite coping
R.W.P.
CHIMNEY CAP
EDGE VIEW
ROOF SIDE
Pierced two sides
Copper flash.
2"x12"
El. 451'6"
Cottonwood panels
Cottonwood
Slate roof
cotton wood panels
Copper
Cottonwood
El. 436'9"
El. 436'0"
8'6" Radius
Loose R.C. Lintel
REVISED SECTION OF CONCOURSE ROOF SHEWING TIMBER CONSTRUCTION...
Copper roof & flash.
Large Conc. Arch & Slab
Flue
Flue
Metal Screen
Ash dump
Plaster
Granite
Ceiling furred down
Brick relieving Arch
Splay
Granite curb
OMIT this Mantle and set one supplied by the Government of B.C.
ash dump
TEMPORARY BROWSING ROOM FIREPLACE showing flues and ash dumps.
32'9" Radius
Revised Wood Roof
Build into concrete, hangers for purlins
Revised height of Roof
Copper flashing
2" Tile fill & mastic asphalt roofing
R. Concrete Roof Trusses
Fibrous Plaster Cornice
Note this roof & truss changed to timber construction of similar design see special details...
Brick Arch
Stencilled pattern
Note:- In all cases such as this brickwork to be corbelled over on slab with thick Bitumen course under.
Wood Stool
Flr. El. 395'
Tile to be carried over heads in South Wing
STAFF WORKROOM
F. Cove Backmold
This trim in Staff Workroom and Seminar Rooms
1¼" x 7" chair rail
This trim in Secretary's & Librarian's Rooms Also Browsing Rm which will have in addition panelled dado (see
Flr. El. 380'
MEN'S LOCKER ROOM
Quint Wall Tiling Substitute Ruled Keens Cement
2" Split Tile
Iron Grating
SIDE WALL TREATMENT IN WING ROOMS
Fin. Ground line
4'3"
12"
Flr. El. 368'
Field pipe drain
Tab.
FRESH AIR DUCT
HALF LONGITUDINAL SECTION
HALF SECTION thro' WINGS.

6

Corrected to date. Dec 17th

Scale ¼" - 1 foot
September 29 1923

UNIVERSITY of BC The LIBRARY BLDG

Sharp & Thompson
A.R.I.B.A. Architects
626 Pender Street
Vancouver B.C.

This is one of the Drawings referred to in the Contract signed by us this 4th day of [illegible]

This copy is provided for [illegible] and reference purposes only. Further reproduction [illegible] is subject to the terms [illegible] the Copyright Act.